SUPER B® tool excellence   TB-DS20   桌上型數位磅秤 使用說明書

1 規格

1.具有高精確度的感應器和高性能的處理器，能夠準確地測量物品重量。
2.精確度:3kg/1g。
3.淨重測量功能。
4.省電功能，自動關機。

2 起始操作

1.打開電池蓋，置入電池(CR-2032)在供電電池位置(請見下圖)。
2.請選擇高品質的電池以避免造成磅秤損壞。
3.將磅秤放置在平坦且穩固的表面。

此處淨空　放置電池位置
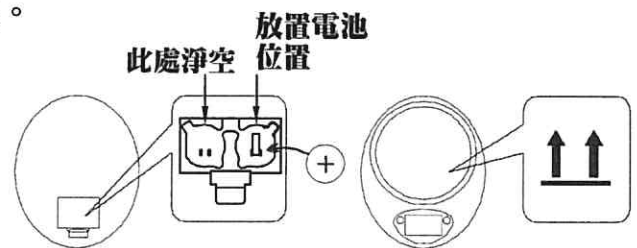
3 秤重操作

1.輕按 "ON/OFF/TARE" 按鍵開啟電源，螢幕出現 "HELO" ，
  等候3秒鐘螢幕出現 "0"。
2.輕按 "UNIT" 鍵選擇單位 "g" 或是 "oz"。
3.將測量物件放置在磅秤上，螢幕將會顯示測量物件的重量。
4.輕按 "ON/OFF/TARE" 按鍵關閉電源，或者是30秒內未使用磅秤，也會自動關
  閉電源。

4 淨重測量

當需要測量容器內的物品時，TB-DS20 可以去除容器的重量。
1.將容器放置在磅秤上，輕按 "ON/OFF/TARE" ，螢幕會顯示 "0" 和 "TARE"。
2.放置物品在容器內，磅秤會顯示物品的重量，你可以歸零後放置更多的物件在
  磅秤上，但是請注意總重勿超過磅秤的承重上限(3公斤)。
3.將所有物件移除磅秤後，螢幕將會顯示歸零時已扣掉的重量，螢幕會另外顯
  示 "-" 在螢幕的左方。
4.輕按 "ON/OFF/TARE" 按鈕螢幕會顯示 "0" 回復到起始狀態。

5 注意事項

1.當螢幕顯示 "Err"，請盡快移除測量物件，這表示物品重量超過載重上限。
2.當螢幕顯示 " □ " ，請盡快更換新電池，這表示電力不足。
3.當螢幕顯示 "OUT2" 且電源關閉，表示測量物件超過載重上限。
4.為了確保磅秤的壽命和準確度，請遠離潮濕過熱或過冷的環境。
5.請小心的移動磅秤避免擠壓或摔落。
6.當表面有髒污時請用柔軟的乾布擦拭。
7.當顯示結果不正確時，請與當地經銷商連絡，請勿自行維修。

TB-DS20   Tabletop digital scale
Instruction

1 Specification

Leave it empty   Battery position

1. Well equipped with high precision sensor and high capability to ensure the weighing accuracy.
2. Capacity: 3kg/1g.
3. Tare function.
4. Save power, auto power off.
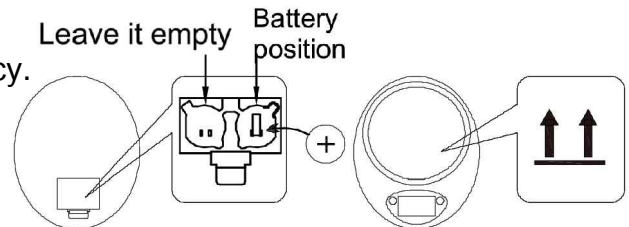
2 Operations

1. Open the battery covet, install the battery (CR2032) to the battery case. (See the picture as above)
2. Use the qualified battery to avoid any injury to scale.
3. Put the scale on a flat and steady table.

3 Weighing step

1. Press slightly the key "ON/OFF/TARE" to power on. The LCD will be zero about 3 sec. After "HELO" appears on the display.
2. Press slightly the key of "UNIT" to choose the unit "g" or "oz".
3. Put the things on the platform, LCD will show the weight of things.
4. Press slightly the key "ON/OFF/TARE" to power off, or Auto power off if the scale stops operation in 30 seconds.

4 Tare function

TB-DS20 can sum up the net weight.
1. Put the container on the platform, press slightly the key "ON/OFF/TARE", the scale will show "0" and show "TARE" on the left of LCD.
2. Put things into the container, it will show additional weight. Press the key "TARE" to weigh more. But please note the total weight of all things can't exceed the maximal capacity of the scale. (MAX 3kg)
3. Take away all the things on the platform, LCD will show the minus weight of all things before tare, it will appear "-" on the left of LCD.
4. Press slightly the key "ON/OFF/TARE", LCD shows "0" reply to the initial condition.

5 Notes

1. When "Err" appear on the LCD, please remove things from platform soon, it means weight overload.
2. When the LCD shows " ▭ ", please change the new batteries in time, it means the power is not enough.
3. When the LCD shows "OUT2" and then power off, it means the object over loaded.
4. Please don't put the scale under wet, hot & cold condition to insure the life of the scale.
5. Don't force or drop the scale and be careful when moved it.
6. Please clean the scale with soft and dry cloth. If the scale surface is dirty.
7. Please contact the local dealers. Don't try to fix by yourself. If the result appears improperly.